


红外测温智能万用表

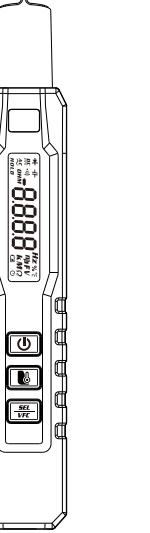

TRUE RMS
CE
CAT.III 600V

1. 安全注意事项

CAT III

使用此仪表时应特别注意，不当的使用可能造成电击或损坏仪表。在使用中应遵循通常的安全规程及完全遵守使用手册所规定的安全措施。

为充分地利用仪器的功能和确保安全操作，请仔细地阅读并遵循说明书的使用方法。

仪表符合 IEC 13978-92 多功能测量仪安全要求，属二级污染，过压标准为 CAT III 600V。

请遵循安全操作指南，保证安全使用仪表。

适当的使用和保护，仪表将给你令人满意的服务。

1. 使用仪表时，用户必须遵守标准的安全规则；
- 通用的防电击保护；
- 防止误用仪表；
2. 接收后，检查是否在运输中损坏；
3. 在恶劣的条件下保存、搬运后，检查并确认仪表是否损坏；
4. 表笔必须处于好的状态，在使用之前，检查表笔的绝缘是否损坏，导线的金属丝是否裸露；
5. 使用时，必须使用正确的功能及量程；
6. 不要超过量程的保护限值进行测量。
7. 在仪表连接到测量电路的时候，不要接触表笔顶端（金属部分），应注意保持手始终接触表笔装置之后。
8. 若测试电压高于 60V DC 或者 30V AC（有效值），不要测量电压。
9. 在测量时，若被测电压大于 60V AC，不要测量电压。
10. 在改变功能之前，应将表笔从被测电路移开。
11. 不要带电插拔任何接线端子。
12. 在电阻及通断测试量程，应小心避免将仪表连接到电源上。
13. 不要在爆炸性的气体、蒸汽或灰尘环境中使用本仪表。
14. 如果发现仪表有任何异常或故障，应停止使用。
15. 不要在阳光直射、高温、高潮湿的环境下存储或使用本仪表。

2. 产品描述

序号 **说明**

1	非接触电压感应区域
2	液晶显示屏
3	电源按键
4	红外测温按键
5	功能切换按键
6	表笔输入端
7	红外测温探头



3. LCD符号说明

符号	说明
DC	直流电压
AC	交流电压
Ω	自动开机标识
CA	低电量提示
+	二极管测量模式
·-·	通断识别符号
Hz	电容测试模式
%	占空比测试百分比符号
HOLD	数据保持
V.mV	伏特，毫伏
mF.uF.nF	毫法，微法，纳法
MΩ.KΩ.Ω	兆欧，千欧，欧姆
ΩH	电阻模式
KHz.Hz	千赫兹，赫兹
°C/°F	摄氏度，华氏度

4. 规格

概述

1. 自动量程。
2. 全量程过载保护。
3. Auto模式：可自动识别交流电压、直流电压、电阻、通断、频率。
4. 显示：LCD。
5. 显示位数：40000计数。
6. 极性指示：自动指示。
7. 超量程显示：“OL”或“-OL”。
8. 采样速率：约0.4秒。
9. 自动关机时间：15分钟。
10. 电池欠压显示：LCD显示“LOW”符号。
11. 工作温度湿度：-10~60°C, 0~80%RH。
12. 存储温度湿度：-10~60°C, 0~70%RH。
13. 供电：1.5V AAA x 2。
14. 工作高度：最大2000米。
15. 尺寸：190*30*31mm。
16. 重量：90g(不含电池)。

技术指标

测试条件：温度 18~28°C，湿度 小于 80%RH。

1. 直流电压

量 程	最 大 分 辨 率	准 确 度
0~400V (DC模式)	0.001V	± (0.8%读数 + 3字)
0~800V (Auto模式)		

2. 交流电压

量 程	最 大 分 辨 率	准 确 度
0~400V (DC模式)	0.001V	± (1.2%读数 + 5字)
0~800V (Auto模式)	0.001V	± (1.2%读数 + 5字)

3. 电阻

量 程	最 大 分 辨 率	准 确 度
0~4000Ω	1Ω	± (1.2%读数 + 5字)
4000Ω~40MΩ		

4. 频率

量 程	最 大 分 辨 率	准 确 度
0Hz~200kHz (0~30VAC)	0.001Hz	± (2.0%读数 + 10字)
0Hz~1000Hz (0~600VAC)		

5. 红外测温

量 程	最 大 分 辨 率	准 确 度
0°C~380°C	0.1°C	± (2.5%读数 + 2°C)
-20°C~380°C (-4°F~716°F)		± (2.5%读数 + 3°C)

6. 其他

功 能	说 明
通 断	被测电阻<50Ω，蜂鸣器发声。 VALT 指示灯亮，蜂鸣器发出不同频率报警。 当检测强信号时，红色背光闪亮表示，非强信号时绿色背光闪亮。
VALT	蜂鸣器发声显示“OL”图标。 当检测强信号时，蜂鸣器发出不同频率报警。 当检测强信号时，红色背光闪亮表示，非强信号时绿色背光闪亮。
LIVE	测试火线显示“---”图标，并发出报警声音。同时红色背光闪亮提示：检测火线无响应。 约15分钟无信号输入，仪表自动关机。

5. 操作说明

1. 长按 **①** 键1秒钟，进入Auto工作模式（Auto模式下可自动识别交流电压、电阻和通断）。

2. 将表笔直接连接到待测电阻。电阻上，仪表自动识别交流电压、电阻、频率。

3. 短按 **①** 键，将选择自动模式：VALT(电压感应)模式、LIVE(火线检测)模式、DC电压、AC电压、电阻模式、通断模式、频率模式。


4. 短按 **②** 键，将选择自动模式：VALT(电压感应)模式、LIVE(火线检测)模式、DC电压、AC电压、电阻模式、通断模式、频率模式。

5. 长按 **③** 键，进入或者退出VFC电压测量模式。


6. 短按 **④** 键，打开或关闭背光。

7. 长按 **⑤** 键，关机。


6. 通断测试(自动模式)

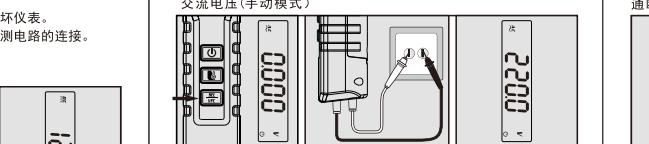


7. 通断测试(手动模式)

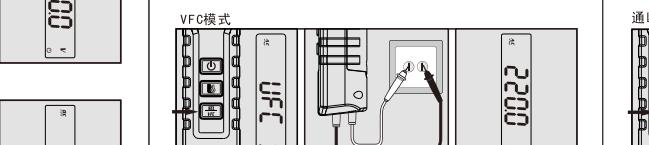


8. 交直流电压(手动模式)

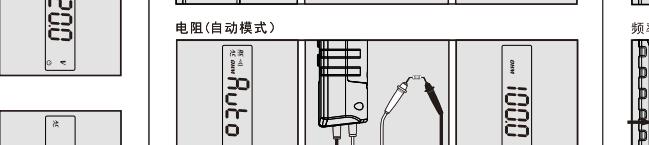


9. 交直流电压(自动模式)

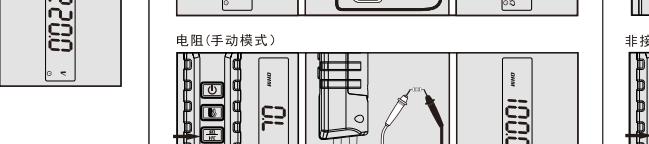


10. 交流电压(手動模式)

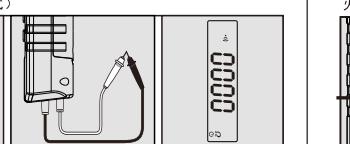


11. 交流电压(自动模式)

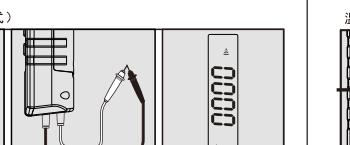


12. 电阻(自动模式)

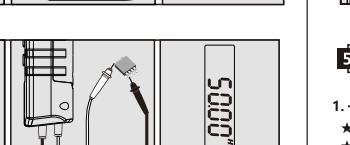


13. 电阻(手动模式)

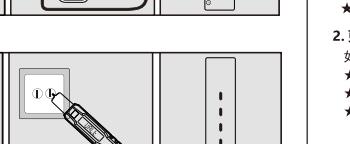

14. 频率测试

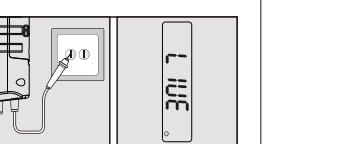

15. 温度

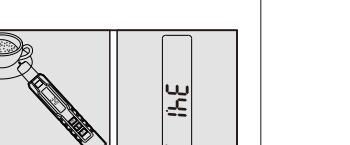

16. 保养与维护


1. 一般保养与维护

- ★ 定期清洁仪表外壳，请勿使用化学溶剂清洁仪表外壳。
- ★ 保持仪表干燥，移动仪表前，拔出后壳。
- ★ 如发现仪表异常，请停止使用并送回校准维修。

2. 更换电池

- 如果仪表出现 **LOW** 符号，更换电池后再使用，否则会影响测量精度。
- ★ 请勿拆卸仪表电源，移除表笔。
- ★ 用螺丝刀卸下尾部螺丝，拔出后壳。
- ★ 更换两节1.5V AAA电池，然后装上后盖并拧上螺丝。

SMART MULTIMETER

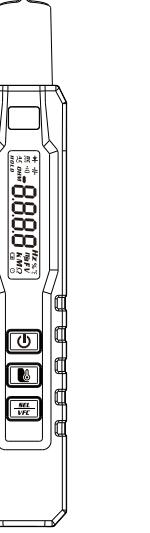

TRUE RMS
CE
CAT.III 600V

1. Security Information

CAT III

Warning: People using this meter should pay special attention to **①**, because the improper use may cause electric shock or damage to the meter. Please follow the actual safety rules and safety measures as specified in the manual.


To fully use the function of this meter and ensure its safety operation, please read and follow its usage methods in the specification carefully.

This meter matched the technical requirement of digital multimeter GB/T 13978-92 and the safety requirement of electronic measuring meter GB4793.1-1995 (IEC 61010-1). It belongs to secondary pollution and its over-voltage standard is CAT III 600V. Please follow the safe operation guide and ensure safe use for this meter.

1. Users must follow the standard safety rules when using it:
 - Non-contact universal protection.
 - To avoid electric shock.
 2. Check if there is any damage on this meter or not in the process of transportation when receiving it.
 3. Check if there is any damage on this meter or not when preserved, loaded and delivered in its poor condition.
 4. The test lead must be in a good condition. Check whether there is any damage on its insulation or not and if meter's sensitive wire is exposed or not before using it.
 5. The test lead resistance and insulation strength must be guaranteed when using it.
 6. Don't overtakes the indicating value of protection extent of every measuring range when testing.
 7. Don't touch the top of test lead (the metal part) when linked meter with measuring circuit.
 8. When testing if the voltage tested is over 60V DC or 30V AC (RMS), please keep your fingers behind the test lead protector.
 9. When testing if the voltage tested is over 600V DC or 600V AC, please stop testing voltage.
 10. Before turning the switch to change the testing function, the test lead should be removed from the measuring circuit.
 11. Do not measure resistance and lines with electricity.
 12. When measuring resistance and lines with electricity, please do not link meter with voltage source.
 13. Don't use the meter under the explosive gas, steam or dust environment.
 14. If there is any abnormality or malfunction in the user, please stop using it.
 15. Multimeter should not be stored unless the meter bottom shell and the battery cover are completely clamped in place.

2. Product Description

① Power button:
 Long press: Power on.
 Long press after power on: Auto shutdown enable/disable.
 Short press: Backlight ON/OFF.
② Infrared temperature test button
 Press and hold: Infrared temperature test.

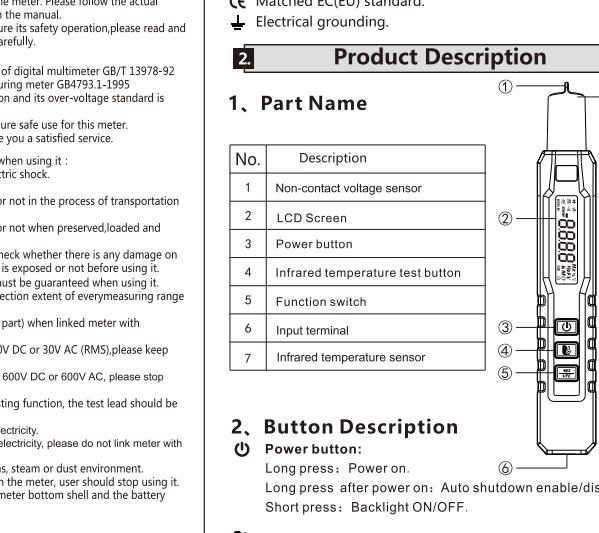

3. LCD full display symbol

Symbol	Explanation
DC	DC voltage
AC	AC voltage
Ω	Auto shutdown function indication
CA	Low battery indication
+	Diode mode
·-·	Continuity
Hz	Capacitance
%	Duty ratio
HOLD	Data hold
V.mV	Voltage unit: volt, millivolt
mF.uF.nF	Capacitance unit
MΩ.KΩ.Ω	Resistance unit
ΩH	Resistance mode
KHz.Hz	Frequency unit
°C/°F	celsius/fahrenheit

4. Specification

Overview

1. Automatic range.
2. Full measuring range overload protection.
3. Auto mode: Automatic identification of AC voltage, DC voltage, resistance, continuity, frequency.
4. Display: LCD.
5. Polarity indication: Self-indicating, '-' means Negative polarity.
6. Over-range display: 'OL' or '-OL'.
7. Sampling time: The meter figures show about 0.4 seconds.
8. Working conditions: Relative humidity < 80% RH.
9. Auto shutdown time: 15 minutes.
10. Battery low voltage indication: LCD display "LOW" symbol.
11. Operational temperature and humidity: -10~60°C, 0~80%RH.
12. Storage temperature and humidity: -10~60°C, 0~70%RH.
13. Battery: 1.5V AAA x 2.
14. Operating altitude: ≤2000m.
15. Dimension: 190*30*31mm.
16. Weight: 90g (without battery).

Technical index

Test conditions: environmental temperature 18 °C to 28 °C, relative humidity <80%RH.

1. DC voltage

Range	Resolution	Accuracy
0~400V (DC mode)	0.001V	± (0.8% + 3 counts)
0~800V (Auto mode)		

2. AC voltage

Range	Resolution	Accuracy
0~400V (DC mode)	0.001V	± (1.2% + 5 counts)
0~800V (Auto mode)	0.001V	± (1.2% + 5 counts)

3. Resistance

Range	Resolution	Accuracy
0~4000Ω	1Ω	± (1.2% + 5 counts)
4000Ω~40MΩ		

4. Frequency

Range	Resolution	Accuracy
0Hz~200kHz (0~30VAC)	0.001Hz	± (2.0% + 10 counts)
0Hz~1000Hz (0~600VAC)		

5. Infrared temperature

Range	Resolution	Accuracy
0°C~380°C	0.1°C	± (2.5% + 2°C)
-20°C~380°C (-4°F~716°F)		± (2.5% + 3°C)


6. Other

Function	Explanation
Continuity	If the resistance < 50Ω, the buzzer sounds.
Non-contact voltage indicator	LCD display "----" icon if live voltage signal recognized, and the buzzer sounds, red backlight flashes when signal strength is high, and green backlight flashes for low strength.
Live wire	LCD display "----" icon if live wire recognized, and the buzzer sounds and red backlight flashes
Auto power off	No signal input for about 15 minutes


6. Operation Instructions

1. Press **①** for 1 seconds to power on, Enter AUTO mode(Auto mode can automatically measure AC/DC voltage, resistance and continuity). Connect the test leads to the voltage or resistance, Meter automatically measure AC voltage, DC voltage and resistance.
 2. Connect the test leads to the voltage or resistance, Meter automatically measure AC voltage, DC voltage and resistance.
 3. Press and hold **②** button, aim the infrared sensor head at the object to be measured and measure the temperature.


7. Measure Continuity (Automatic mode)

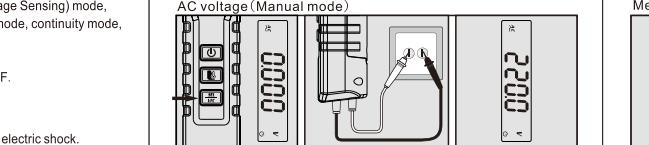


8. Measure Continuity (Manual mode)

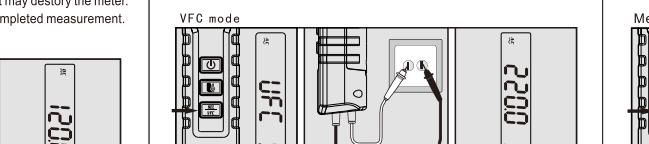


9. AC voltage (Automatic mode)

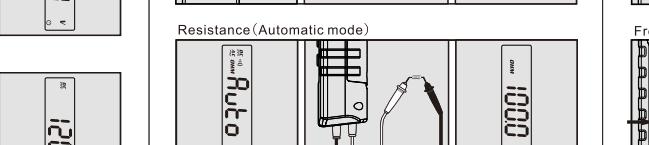


10. AC voltage (Manual mode)

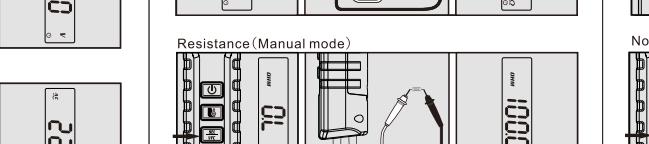


11. DC voltage (Automatic mode)

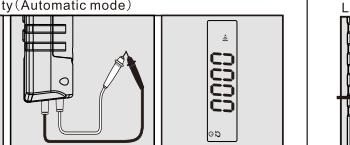


12. DC voltage (Manual mode)

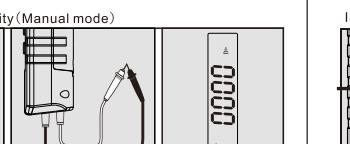


13. Resistance (Automatic mode)

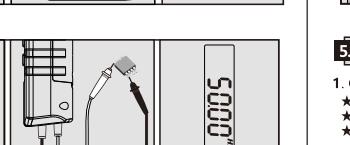


14. Resistance (Manual mode)

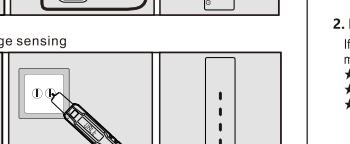

15. Frequency

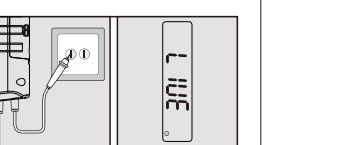

16. Infrared temperature measurement

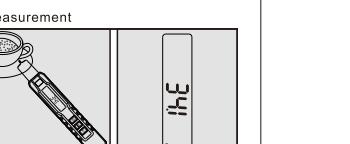

17. Maintenance

1. General maintenance

- ★ Clean the meter casing regularly. Do not clean with chemical solvents.
- ★ Keep the meter input jack dry and clean.
- ★ If the meter is abnormal, please stop using it and return it for calibration and maintenance.

2. Replace the battery

- If **LOW** symbol appears, it should be charged before use, otherwise the measurement may not be accurate.
- ★ Shut down the meter and remove test leads.
- ★ Remove the tail screw with a screwdriver, and pull out the rear case.
- ★ Replace two 1.5V AAA batteries, then install the back cover and screw.