

## User Manual

### A. Introduction

This product is a battery-powered, true-rms, auto-ranging digital multimeter with a 4000 counts, LCD display and backlight.

### B. Safety Information

To avoid possible electrical shock, fire, or personal injury, please read all safety information before you use the product.

- Do **NOT** exceed the "maximum value" indicated in the Specification.
- Examine the connection of the test leads and the insulation of the product before measuring voltage higher than 36V DC or 25V AC.
- Disconnect the test leads from the circuit before changing the mode.
- Misuse of mode or range can lead to hazards, be cautious. "OL" will be shown on the display when the input is out of range.
- Safety symbols:

	Hazardous Voltage		Earth
	Double Insulated		Low Battery
	Risk of Danger. Check the User Manual.		

### C. Specifications

Electrical Specifications					
Function	Range	Resolution	Accuracy	MAX.Value	Other
DC Voltage (V)	4.000V	0.001V	±(0.5%+3)	600V	
	40.00V	0.01V			
	400.0V	0.1V			
	600V	1V			
DC Voltage (mV)	400.0mV	0.1mV		400.0mV	
AC Voltage (V)	4.000V	0.001V	±(1.0%+3)	600V	
	40.00V	0.01V			
	400.0V	0.1V			
	600V	1V			
AC Voltage (mV)	400.0mV	0.1mV		400.0mV	
DC Current (A)	10.00A	0.01A	±(1.2%+3)	10.00A	MAX.Current: 10A (no more than 15 seconds) No Voltage input at this mode
DC Current (mA)	40.00mA	0.01mA		400.0mA	
	400.0mA	0.1mA		400.0μA	
DC Current (μA)	400.0μA	0.1μA		400.0μA	
AC Current (A)	10.00A	0.01A	±(1.5%+3)	10.00A	Frequency Response(AC): 40Hz-1kHz
AC Current (mA)	40.00mA	0.01mA		400.0mA	
	400.0mA	0.1mA		400.0μA	
AC Current (μA)	400.0μA	0.1μA		400.0μA	

Function	Range	Resolution	Accuracy	MAX.Value	Other
Resistance	400.0 Ω	0.1 Ω	±(0.5%+3)	40.00MΩ	No Voltage input at this mode
	4.000k Ω	0.001k Ω			
	40.00k Ω	0.01k Ω			
	400.0k Ω	0.1k Ω			
Capacitance	40.00M Ω	0.01M Ω	±(5.0%+20)	4.000mF	No Voltage input at this mode
	4.000nF	0.001nF			
	40.00nF	0.01nF			
	400.0nF	0.1nF			
	4.000 μ F	0.001 μ F			
	40.00 μ F	0.01 μ F			
Frequency	400.0 μ F	0.1 μ F	±(2.0%+5)	4.000MHz	
	4.000mF	0.001mF			
	40.00Hz	0.01Hz			
	4000.0Hz	0.1Hz			
	4.000kHz	0.001kHz			
	40.00kHz	0.01kHz			
4000.0kHz	0.1kHz				
4.000MHz	0.001MHz	±(5.0%+5)			
Diode	V(DC forward current is 5mA, voltage is 3V)				No Voltage input at this mode
Continuity	V(no more than 50Ω)				No Voltage input at this mode

General Specifications		Mechanical Specifications	
Display (LCD)	4000 counts	Dimension	130*65*32mm
Ranging	Manual	Weight	114g/128g(w/ batteries)
Material	ABS	Battery Type	1.5V AAA Battery * 2
Update Rate	3 times/second	Warranty	One year
Ture RMS	√	Environmental Specifications	
Data Hold	√	Operating	Temperature 0~40°C
Backlight	√		Humidity <75%
Low Battery Alert	√	Storage	Temperature -20~60°C
Auto Power Off	√		Humidity <80%

### D. Instruction

#### (1) Front Panel ( see the picture on the right )

- LCD display
- buttons

- HOLD: To hold the current reading, press this button and you will see "HOLD" on the display; press again to cancel. To turn on the backlight, press this button for more than 2 seconds; long-press again to turn off.
- SELECT: To toggle between AC/DC, Diode/Capacitance/Continuity, or °C/°F, press this button.

- Rotary Switch: To change mode or range. (from OFF, clockwise)

- OFF
- AC/DC Voltage (V) (Voltage-V)
- AC/DC Voltage (mV) (Voltage-mV)
- NCV
- Capacitance
- Temperature
- AC/DC Current (A) (Current-A)
- AC/DC Current (mA) (Current-mA)
- Diode/Continuity
- Resistance

- Input terminal for voltage, resistance, capacitance, frequency, current (mA), continuity, diode, and duty cycle measurements.
- COM: Common terminal for all measurements.
- 10A: Input terminal for current (V) measurements.


#### (2) Measure AC/DC Current

- Connect the black test lead to the COM Terminal and connect the red test lead to the  $\frac{V}{\mu A}$  Terminal or the 10A Terminal (choose based on the value of current);
- Turn the rotary switch to the 400μA~10A Mode;
- Break the circuit path to be measured. Then connect the test leads across the break and apply power;
- Read the measured current on the display.

#### \*Caution:

- Do not measure current that exceeds the MAX Value as indicated in the Specifications;
- Use the 10A Terminal and the Current-10A Mode when you are measuring an unknown current. Then switch to the other terminals if necessary.

**Do not input voltage exceeds 36V DC or 25V AC when you are at the setting of measuring current.**

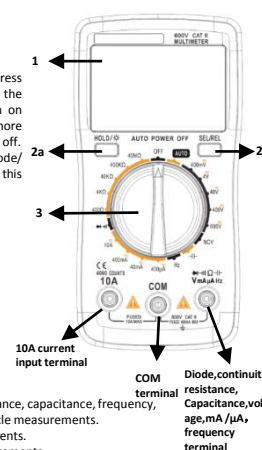

(3) Measure AC/DC Voltage

1. Connect the black test lead to the COM Terminal and connect the red test lead to the Terminal;
2. Turn the rotary switch from 400mV~600V range;
3. Touch the probes to the correct test points of the circuit to measure the voltage;
4. Read the measured voltage on the display.

\*Caution:

- a. Do not measure voltage that exceeds the MAX Value as indicated in the Specifications;
- b. Do not touch high voltage circuit during measurements.

(4) Measure NCV

1. Turn the rotary to NCV Mode;
2. Hold the product and move it around, the built-in beeper will beep when the inner sensor detects AC voltage nearby. The stronger the voltage is, the quicker the beeper beeps.
3. Put the red probe into the terminal, then use the black probe to touch the Live line and Neutral line of the Main supply. You can judge the L-line or N-line by the beeps, if you can hear the strong beeps, this is the L-line, or it's a N-line.

(5) Measure Resistance

1. Connect the black test lead to the COM Terminal and connect the red test lead to the Terminal;
2. Turn the rotary switch from 400Ω~40MΩ range, and the display will show "OL";
3. Touch the probes to the desired test points of the circuit to measure the resistance;
4. Read the measured resistance on the display.

\*Caution:

- a. Disconnect circuit power and discharge all capacitors before you test resistance.
- b. Do not input voltage at the Resistance Mode.

(6) Measure Continuity

1. Connect the black test lead to the COM Terminal and connect the red test lead to the Terminal;
2. Turn the rotary switch from 400Ω~40MΩ range,
3. Touch the probes to the desired test points of the circuit;
4. The built-in beeper will beep when the resistance is lower than 50Ω, which indicates a short circuit.

\*Caution:

- a. Do not input voltage at the Continuity Mode.

(7) Measure Diode

1. Connect the black test lead to the COM Terminal and connect the red test lead to the Terminal;
2. Turn the rotary switch to the diode Mode;
3. Connect the red probe to the anode side and the black probe to the cathode side of the diode being tested;
4. Read the forward bias voltage value on the display;
5. If the polarity of the test leads is reversed with diode polarity or the diode is broken, the display reading shows "OL".

\*Caution:

- a. Do not input voltage at the Diode Mode.
- b. Disconnect circuit power and discharge all capacitors before you test diode.

(8) Measure Capacitance

1. Connect the black test lead to the COM Terminal and connect the red test lead to the Terminal;
2. Turn the rotary switch to the ;
3. Connect the red probe to the anode side and the black probe to the cathode side of the capacitor being tested;
4. Read the measured capacitance value on the display once the reading is stabilized.

\*Caution:

- a. Disconnect circuit power and discharge all capacitors before you test capacitance.

(9) Measure Frequency

1. Connect the black test lead to the COM Terminal and connect the red test lead to the Terminal;
2. Turn the rotary switch to the Frequency Mode;
3. Touch the probes to the desired test points of the circuit;
4. Read the measured frequency value on the display.

\*Caution:

- a. The Frequency Mode only applies to measure high frequency with low voltage.

(10) Auto Power Off

1. The product automatically powers off after 15 minutes of inactivity;
2. The built-in beeper beeps 5 times 1 minute before power off;
3. To restart the product, press SELECT button;
4. To disable the Auto Power Off function, hold down the SELECT button when turning on the product, you will hear five beeps if you have successfully disabled the function.

E. General Maintenance

Beyond replacing batteries and fuses, do not attempt to repair or service the product unless you are qualified to do so and have the relevant calibration, performance test, and service instructions.

- (1) Do not operate the product around hot, wet, flammable, explosive or magnetic environments.
- (2) Clean the product with damp cloth and mild detergent; do not use abrasives or solvents.
- (3) Remove the input signals before you clean the product.
- (4) Remove the batteries if you will not use the product for a long time to prevent possible battery leak.
- (5) When is shown on the display, batteries shall be replaced as below:
  1. Loosen the screw and remove the battery cover;
  2. Replace the used batteries with new batteries of the same type;
  3. Place the battery cover back and fasten the screw.
- (6) Replace fuses as above steps. Use only fuses of the same type as the original ones.

**Warning:**

1. Do NOT exceed the "maximum value" indicated in the Specification;
2. Do NOT input voltage at the Current Mode, the Resistance Mode, the Diode Mode, or the Continuity Mode;
3. Do NOT use the product when the batteries or the battery cover is not placed properly;
4. Turn off the product and remove the test leads from the test points before changing batteries or fuses.

F. Troubleshooting

If your product do not function as normal, the following steps may help you. If the problem still cannot be solved, please contact your dealer.

Problem	Possible Reason
Display Malfunction	Low battery; replace batteries
Symbol	Replace batteries
No current input	Replace fuse

**LIMITED WARRANTY AND LIMITATION OF LIABILITY**

Customers enjoy one-year warranty from the date of purchase. This warranty does not cover fuses, disposable batteries, or damage from accident, neglect, misuse, alternation, contamination, or abnormal conditions of operation or handling.

All rights reserved. Specifications are subject to change without notice.